STAR ONLINE PUBLICATION

Case Number: S2308000118 Rev.A


Release Date: February 2024

Symptom/Vehicle Issue: Malfunction Indicator Lamp (MIL) on

Technician Observation: The technician observed the Power Train Control Module (PCM) has set one or more of the following Diagnostic Trouble Codes (DTCs) as stored or active.

P0052 - O2 2/1 Heater Sensor Circuit High
P0152 – O2 Sensor 2/1 High
P0038 - O2 Sensor 1/2 Heater Circuit High
P0058 - O2 Sensor 2/2 Heater Circuit High
P0132 - O2 Sensor 1/1 Circuit High
P0138 - O2 Sensor 1/2 Circuit High
P0158 - O2 Sensor 2/2 Circuit High
P0037-O2 Sensor 1/2 Heater Circuit Low
P0051-O2 Sensor 2/1 Heater Circuit Low
P0057-O2 Sensor 2/2 Heater Circuit Low
P0131-O2 Sensor 1/1 Circuit Low
P0137-O2 Sensor 1/2 Circuit Low
P0157-O2 Sensor 2/2 Circuit Low
P0113 Intake Air Temperature Sensor 1 Circuit High

Discussion: Inspect the inline connector XY237A Black 16-way for the any pushed out, spread or damaged terminals. Secure and or replace the involved circuit terminals as needed. Repair Kit Part Number: 68018957AA.

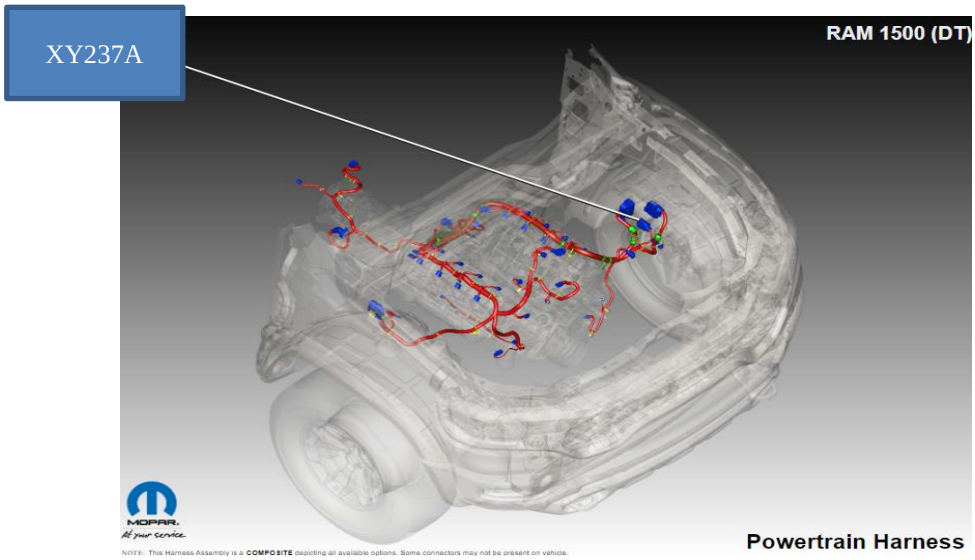

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechCONNECT or eCONTACT ticket if no solution is found