STAR ONLINE PUBLICATION


Case Number: S2308000159

Release Date: December 2023

Symptom/Vehicle Issue: Malfunction Indicator Lamp (MIL) on, Service 4WD System Message on the Cluster Display

Customer Complaint/Technician Observation: Owner complains of a Mil on and/or a Service 4wd message appearing on the cluster. Technician observed the vehicle may have set any of the following Diagnostic Trouble Codes (DTCs): P2008, C140A, C1406, C1406, P258B, C1252, P1004, P2017, U0120, U0158, U1817 or CAN C Bus U0001-00.

Repair Procedure: Inspect the Grey 48-way connector, passenger side engine compartment. Inspect for signs of water intrusion and or corrosion, pushed out or spread terminals. Repair or replace the terminals as needed.

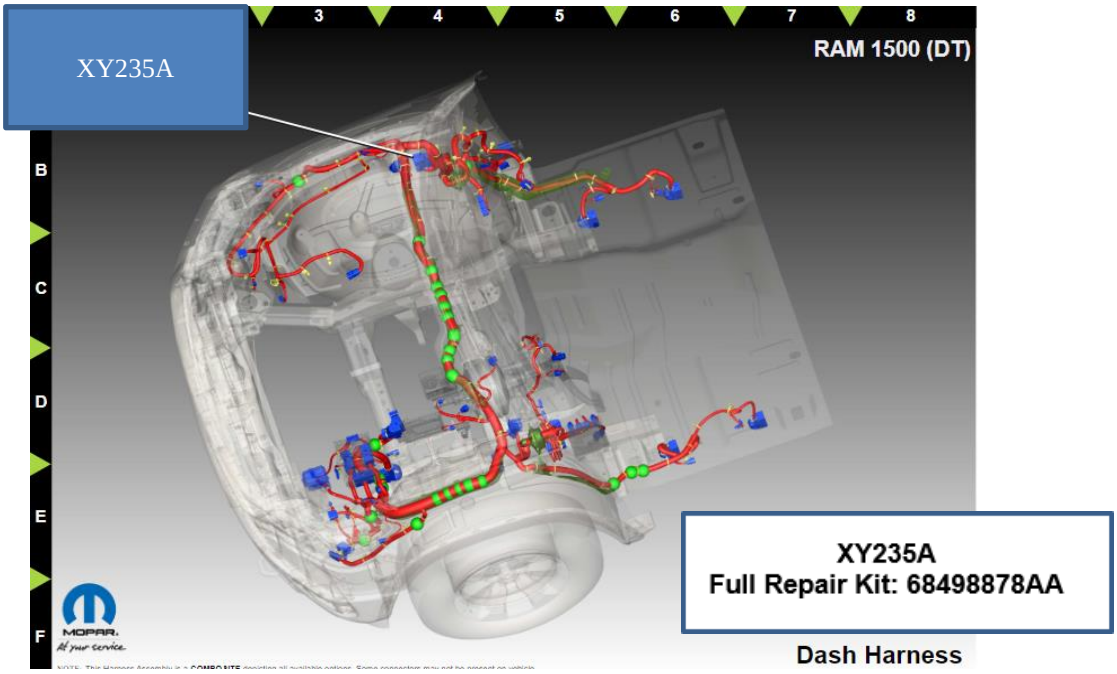

XY235A 48 -way grey connectorXY235A

This document does not authorize warranty repairs. This communication documents a record of past experiences. STAR Online does not provide any conclusions about what is wrong with the vehicle. Rather, it captures all previous cases known that appear to be similar or related to the vehicle symptom / condition. You are the expert, and you are responsible for deciding on the appropriate course of action.

Contact STAR Center, or your Technical Assistance Center Via TechConnect, eCONTACT or Service Library entry if no solution is found.